

Albrecht Servicemitteilung 6. September 2000 LPD Sporty Family 2

Problem:

Bei einem Funkgerät, was eine Zeit lang (je nach Gerät zwischen ein paar Minuten oder einer halben Stunde) zwar eingeschaltet ist, aber ohne Funkbetrieb läuft, funktioniert plötzlich weder Senden noch Empfang, obwohl das Display normale Funktionen suggeriert. Wird das Gerät dann einmal aus- und wieder eingeschaltet, ist alles wieder für eine bestimmte Zeit in Ordnung.
- After some minutes of StandBy, the LPD does no more receive and transmit, but display seems to show normal functions.

Ursache und Abhilfe:

Leider war bei einem kleinen Teil der Produktionsserie Mai 2000 mit Seriennummern oberhalb von "101 A 001395" in einer zugelieferten Baugruppe ein falscher Widerstandswert eingebaut worden. Da dieser Widerstand (R 507, falscher Wert 10 kOhm, Sollwert 33 kOhm) schwer zugänglich ist, bitten wir um Einsendung betroffener Geräte an:

**Albrecht Electronic GmbH
Dovenkamp 11
D- 22952 Lütjensee**

Das Gerät wird umgehend ausgetauscht.

In a small quantity of Mai 2000 production, a resistor R 507 with a wrong value (10 k instead of 33 k) had been used. Because this part is very difficult to replace, defective units shall be shipped back to Albrecht for replacement. The problem happens only at serial numbers "101A 001000" and higher.

Albrecht Service-Team

